



TECHNICAL INFORMATION

TYPE NO ES 5100	TYPE ES	T.I.-NO ... 10/01
SERIAL NUMBERS AFFECTED From machine No 508210	ISSUED BY Documentation/ Wittenborg Odense	
SUBJECT New EPROM for ES 5100	ISSUED FOR (X): Action <input checked="" type="checkbox"/> Information <input checked="" type="checkbox"/>	

COMPONENTS CONCERNED

New: 48001510 **EPROM (ES) - program version 00601390**

Omitted: 48001509 **EPROM (ES) - program version 00601190**

Current: 48001509 **EPROM (FB/IN/CV) - program version 00601190**

MODIFICATION:

- From machine number 508210, the EPROM 48001509 - program version 00601190 will be replaced by a new EPROM 48001510 - program version 00601390 for ES 5100 machines.
- The current EPROM 48001509 - program version 00601190 will still be fitted with FB/IN/CV 5100 machines.
- The new EPROM 48001510 may be used as a service solution for FB 5100 machines as well as ES 5100 machines. The settings are automatically upgraded when the EPROM is changed from current 48001509 EPROM to new 48001510 EPROM.

REASON:

- Correction of software errors in program version 00601190, please see enclosed release note for details. - All ES 5100 functions have been tested in the new EPROM.
- The current EPROM will still be fitted with FB 5100 machines, because a much longer and thorough test will be needed before the new EPROM can be fitted in FB 5100 machines. - Until now the main functions of the FB 5100 have been tested in the new EPROM.

CONTACT PERSONS:

Technical support:
Bent Erik Truelsegaard

Spare Parts:
Customer service

09.10.01 DATE :	<u>Charlotte Schreiner</u> PRODUCED BY :	09.10.01 DATE :	<u>Bent Erik Truelsegaard</u> CHECKED BY :
--------------------	---	--------------------	---

RELEASE NOTE – FB/IN/ES 5100

Dear Sirs

We have released new software for 5100 series. The release includes a new version of the following program(s):

Program Type	Version	Check Sum
VMC-5100	00601390	30D0

If the release includes more than one program type, all the program types in the release must be replaced when replacing programs in installed machines.

The below procedure must be followed when making copies.

- 1.The check sum of the master E-prom must be checked before copies are made.
- 2.For each set of copies which is programmed at a time, the check sum for at least one of the copies must be checked.

This software will run in all 5100 models using the 47107602 VMC board.

The following errors in the VMC_5100 00601190 E-PROM have been corrected in this release:

1. It is not possible to enter the “top stop” window from the menu system in the FB version.

Work around: Read in top stop time using EVA-DTS or the configurator to set top stop time if required.
2. In the ES machines it is not possible to enter the “Rinse brewer/mixer” window and access the rinse function.

Yours sincerely
Wittenborg A/S

Kim Dalgaard Andersen