

TECHNICAL INFORMATION

TYPE NO <p style="text-align: center;">FB/IN/ES 5100</p>	TYPE <p style="text-align: center;">FB/IN/ES</p>	T.I.-NO <p style="text-align: center;">... 06/01</p>				
SERIAL NUMBERS AFFECTED From machine number 500513		ISSUED BY Documentation/ Wittenborg Odense				
SUBJECT <p style="text-align: center;">Vending machine controller 47107602</p>		ISSUED FOR (X): <table border="1" style="width: 100%; border-collapse: collapse;"> <tr> <td style="padding: 2px;">Action</td> <td style="width: 20px;"></td> </tr> <tr> <td style="padding: 2px;">Information</td> <td style="text-align: center;"><input checked="" type="checkbox"/></td> </tr> </table>	Action		Information	<input checked="" type="checkbox"/>
Action						
Information	<input checked="" type="checkbox"/>					

COMPONENT CONCERNED


New part No: 47107602 ver. 1.1 Vending machine controller

Old part No: 47107602 ver. 1.0 Vending machine controller

MODIFICATION

- From the above machine number a noise capacitor 100pF will be mounted on the above mentioned vending machine controller.

Noise capacitor

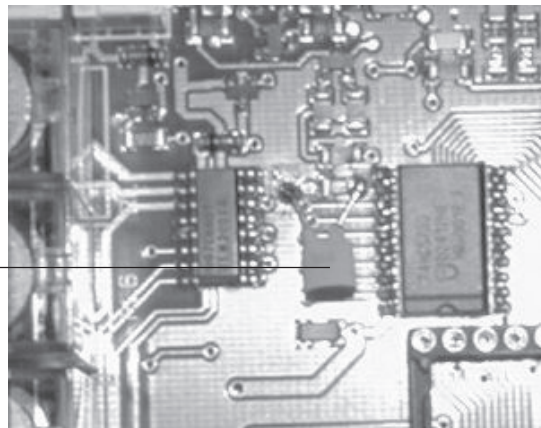

REASON

- In some machines it could happen that the SPC did not respond on a selection. Noise from the fan motor relay could disturb the electronics.
After having mounted the noise capacitor 100pF the problem has been solved.

CONTACT PERSON

Spare Parts:
Customer Service

Technical:
Bent Erik Truelsegaard

23.03.01 DATE :	Charlotte Schreiner PRODUCED BY :
23.03.01 DATE :	Bent Erik Truelsegaard CHECKED BY :